

Software update instruction for X-127 to v3.9 incl. DAB firmware

Change notes for SW v3.9 and DAB firmware version (VOA-000C0A-01-0121-011F):

Note:

The version information can be found under SETTINGS > Others.

The DAB firmware version can be found in the DAB source > Settings.

- Google Android Auto will be activated in this Version.
 - o The setting for FAV button now allows to set Google Android Auto to the FAV front key button.
- General:
 - TFT mode can be used now for older cars using front headlights as daytime running lights to manually set DAY and NIGHT mode for Smartphone connections.
 - DAB FW and APP improved the access of station cover display from database after system start or source change to DAB.
 - Fixed an issue with battery disconnection and reconnection of B+ and ACC wire where the SWC mode selection was not restored to user setting.
 - Improved a rare case issue where DAB audio was stopped even if signal quality was OK.

Step: 1 Download of SW and preparation of a USB flash drive for the update process:


1.1 Download the self-extracting archive update file (exe file) from the XZENT website. Copy the self-extracting file to a USB flash drive (≤ 8 GB, FAT32 format). See picture 1.



1.2


Double click the EXE file and extract directly to root directory of the USB flash drive.

See picture 2.

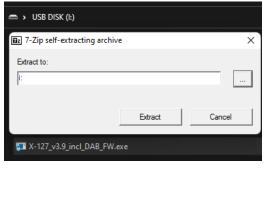

1.3

After the extraction is completed you receive 2 files, GIMINI_PACK.BIN, sppf_Autochips.img and a folder "T4E-FW". See picture 3.

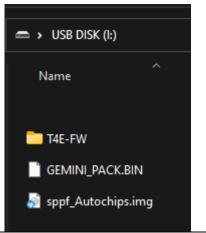

Attention: in some rare cases, the USB-flash-drive may not be detected by the XZENT device or the update fails (continuous restart and retry loop). If one step fails, please re-check and re-use a different brand/manufacturer USB flash drive item and/or change the memory size (<1 GB, 2 GB, 4 GB ...) and/or repeat the download and extraction as shown above.

Do NOT download and execute (extraction) directly to PC.

Do not copy the multiple extracted files to your USB flash drive – copy the single archive file to the USB flash drive and extract it there.



Software update instruction for X-127 to v3.9 incl. DAB firmware


Step 2: APP and MCU (~10 min.):

Duration of GEMINI_PACK.BIN (APP) / sppf_Autochips.img (MCU) update is approx. 10 min. (without preparation time).

To start the v3.9 update, connect the USB flash drive to USB-1, you need to go to Setup > Others > Install Software

• If you cannot confirm the OK-Button, the USB flash drive is connected to the wrong USB port or the files are not put on root directory as shown in step1. Please check the port and the USB flash drive.

After you confirm to install the SW, the device will auto-restart itself and follow the sequence shown in the arrow diagram below from A to G. Please ensure that the process is correct and that no parts are skipped. If steps are accidentally skipped, this is an indication that the files or the USB flash drive are not working properly. Review and repeat the step 1 but use a different USB flash drive (other brand or size but FAT32 format).

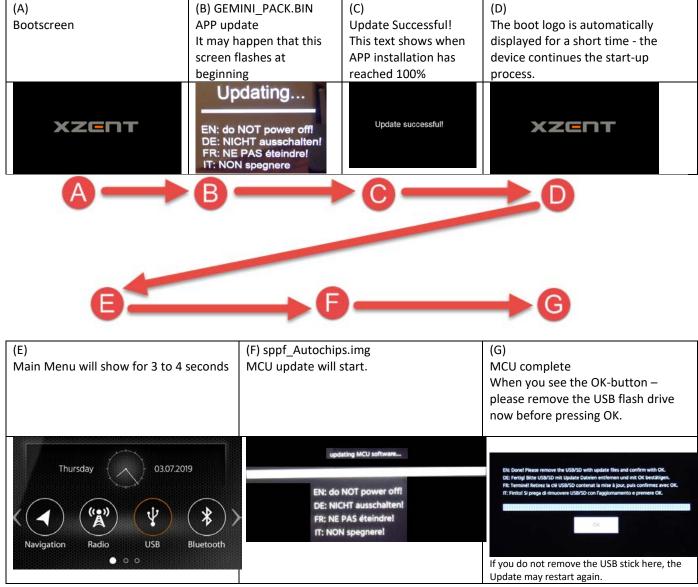

Attention: The systems default language changed to English. To change the language to your desired language, now or after Step 4, longpress the FAV front hard key button. The system language can be changed in the first line "General".



Software update instruction for X-127 to v3.9 incl. DAB firmware

Compare the APP and MCU version to match with the version as shown below:

<u>Version: X-127 v3.9</u>

APP: 20220901_1901

OS: 24.0.2.2.2.0.1.0

MCU: SP_A_034_20220625_01.AJO.L

Tuner DB: 2022-04-29

Step 3: DAB firmware update (~5 min.)

If you have finished the APP and MCU update you can remove the GIMINI_PACK.BIN (APP), sppf_Autochips.img (MCU) from the USB flash drive to avoid restart of update process. The <<T4E-FW>> folder should remain on the Update USB flash drive.

Proceed now with the DAB-FW update.

- 3.1 While the device is still powered on, connect the USB flash drive to USB-1.
- 3.2 Select the DAB source to start the DAB FW update. A pop up "Update Firmware" should appear approx. for 3 seconds after entering the source while the USB flash drive with correct files is on USB-1 detected.



3.3 As soon as the progress bar is updating you can safely remove the USB flash drive to avoid re-updating the device by accident on auto restart after the progress bar reaches 100% of DAB FW progress.

After successful DAB firmware installation, verify that DAB FW has been correctly installed. It should show:

< VOA-000C0A-01-0121-011F > (DAB source > Settings).

Comfort Scan DAB Service Following Antenna Supply DAB Firmware V0A-000C0A-01-0121-011F Preset FM

Step 4: Loading Factory Settings

Load factory settings from Setup > Others > Load Factory > OK

Your device is now ready for regular use.

Attention: The systems default language changed to English. To change the language to your desired language longpress the FAV front hard key button. The system language can be changed in the first line "General".